

Installation Instructions

Connector Attachment

For Braided Cable CNT-240, CNT-300, CNT-400
 Captivated Pin, Crimp-type Body,
 IP68 Connectors (*-CS8)



1 Remove 21.0 mm (0.827") of Jacket only.

2 Slide parts A onto the braid of cable, comb braid straight with a wire brush.

3 Fold braid around part A and comb braid as shown, the braid should be straight and equally spaced after comb.

4 Cut off the redundant braid as shown.

5 Remove foam along fold braid side, exposing center conductor, trim center conductor as shown.

6 Chamfer the center conductor at a 45° angle.

7 Daub grease onto braid uniformly.

8 The cable attachment must be straight and aligned with the hole of connector inner contact. Insert the cable attachment into connector body until stopped; the cable center conductor must be inserted into inner contact fingers. Make sure the braid cover on body sleeve and push part A onto braid.

9 Crimp the body at the area as shown. Crimp tool part number see table.

CABLE	TOOL	D
CNT-400	CTBC	10.9 mm (0.429")
CNT-300	CTBC	8.2 mm (0.323")
CNT-240	CTBC-2	6.5 mm (0.256")

部件名称 (Part Name)	表一 有毒有害物质或元素名称及含量标识格式					
	有毒有害物质或元素					
	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr6+)	多溴联苯 (PBB)	多溴二苯醚 (PBDE)
连接器 (Connector)	X	O	O	O	O	O

O: 表示有毒有害物质在该部件所有的均质材料中的含量均在 SJ/T 11363-2006规定的限量要求以下。
 X: 表示该有毒有害物质至少在该部件的某一均质材料中的含量超出 SJ/T 11363-2006规定的限量要求。



Installation Training Available at Andrew Institute

Notice: Andrew disclaims any liability or responsibility for the results of improper or unsafe installation, in spection, maintenance, or removal practices

Andrew Corporation
 3 Westbrook Corporate Center, Suite 900, Westchester, Illinois U.S.A. 60154
 +1 (779) 435-8579 Fax (U.S.A.): 1-800-349-5444
 www.andrew.com
 Copyright © 2008 by Andrew Corporation

Customer Service, 24 hours
 U.S.A., Canada, Mexico: 1-800-255-1479
 U.K.: 0800 250055
 Other Europe: +44 592 782 612
 China: +86 512-6256-8805

